

SERVICE PARTS LIST FOR MITSUBISHI ELECTRIC PACKAGED AIR-CONDITIONERS

**Series : PURY-HP•T(S)NU-A
PURY-HP•Y(S)NU-A**

For use with the R410A

REVISED

May 2024

BWE01906A

INDEX
PURY-HP72TNU-A PURY-HP96TNU-A PURY-HP120TNU-A PURY-HP72YNU-A PURY-HP96YNU-A PURY-HP120YNU-A

Part information update day : **2024/05/20**

Please change the old catalog (issued May 2019, No.BWE019060) to this new catalog.
Content of revision : Some of parts are changed.



The Package name list

PURY-HP144TSNU-A [PURY-HP72TNU-A+PURY-HP72TNU-A]

PURY-HP192TSNU-A [PURY-HP96TNU-A+PURY-HP96TNU-A]

PURY-HP240TSNU-A [PURY-HP120TNU-A+PURY-HP120TNU-A]


PURY-HP144YSNU-A [PURY-HP72YNU-A+PURY-HP72YNU-A]

PURY-HP192YSNU-A [PURY-HP96YNU-A+PURY-HP96YNU-A]

PURY-HP240YSNU-A [PURY-HP120YNU-A+PURY-HP120YNU-A]

PURY-HP72,HP96,HP120TNU-A
PURY-HP72,HP96,HP120YNU-A


EXTERNAL PARTS & BLOWER PARTS (1-1)

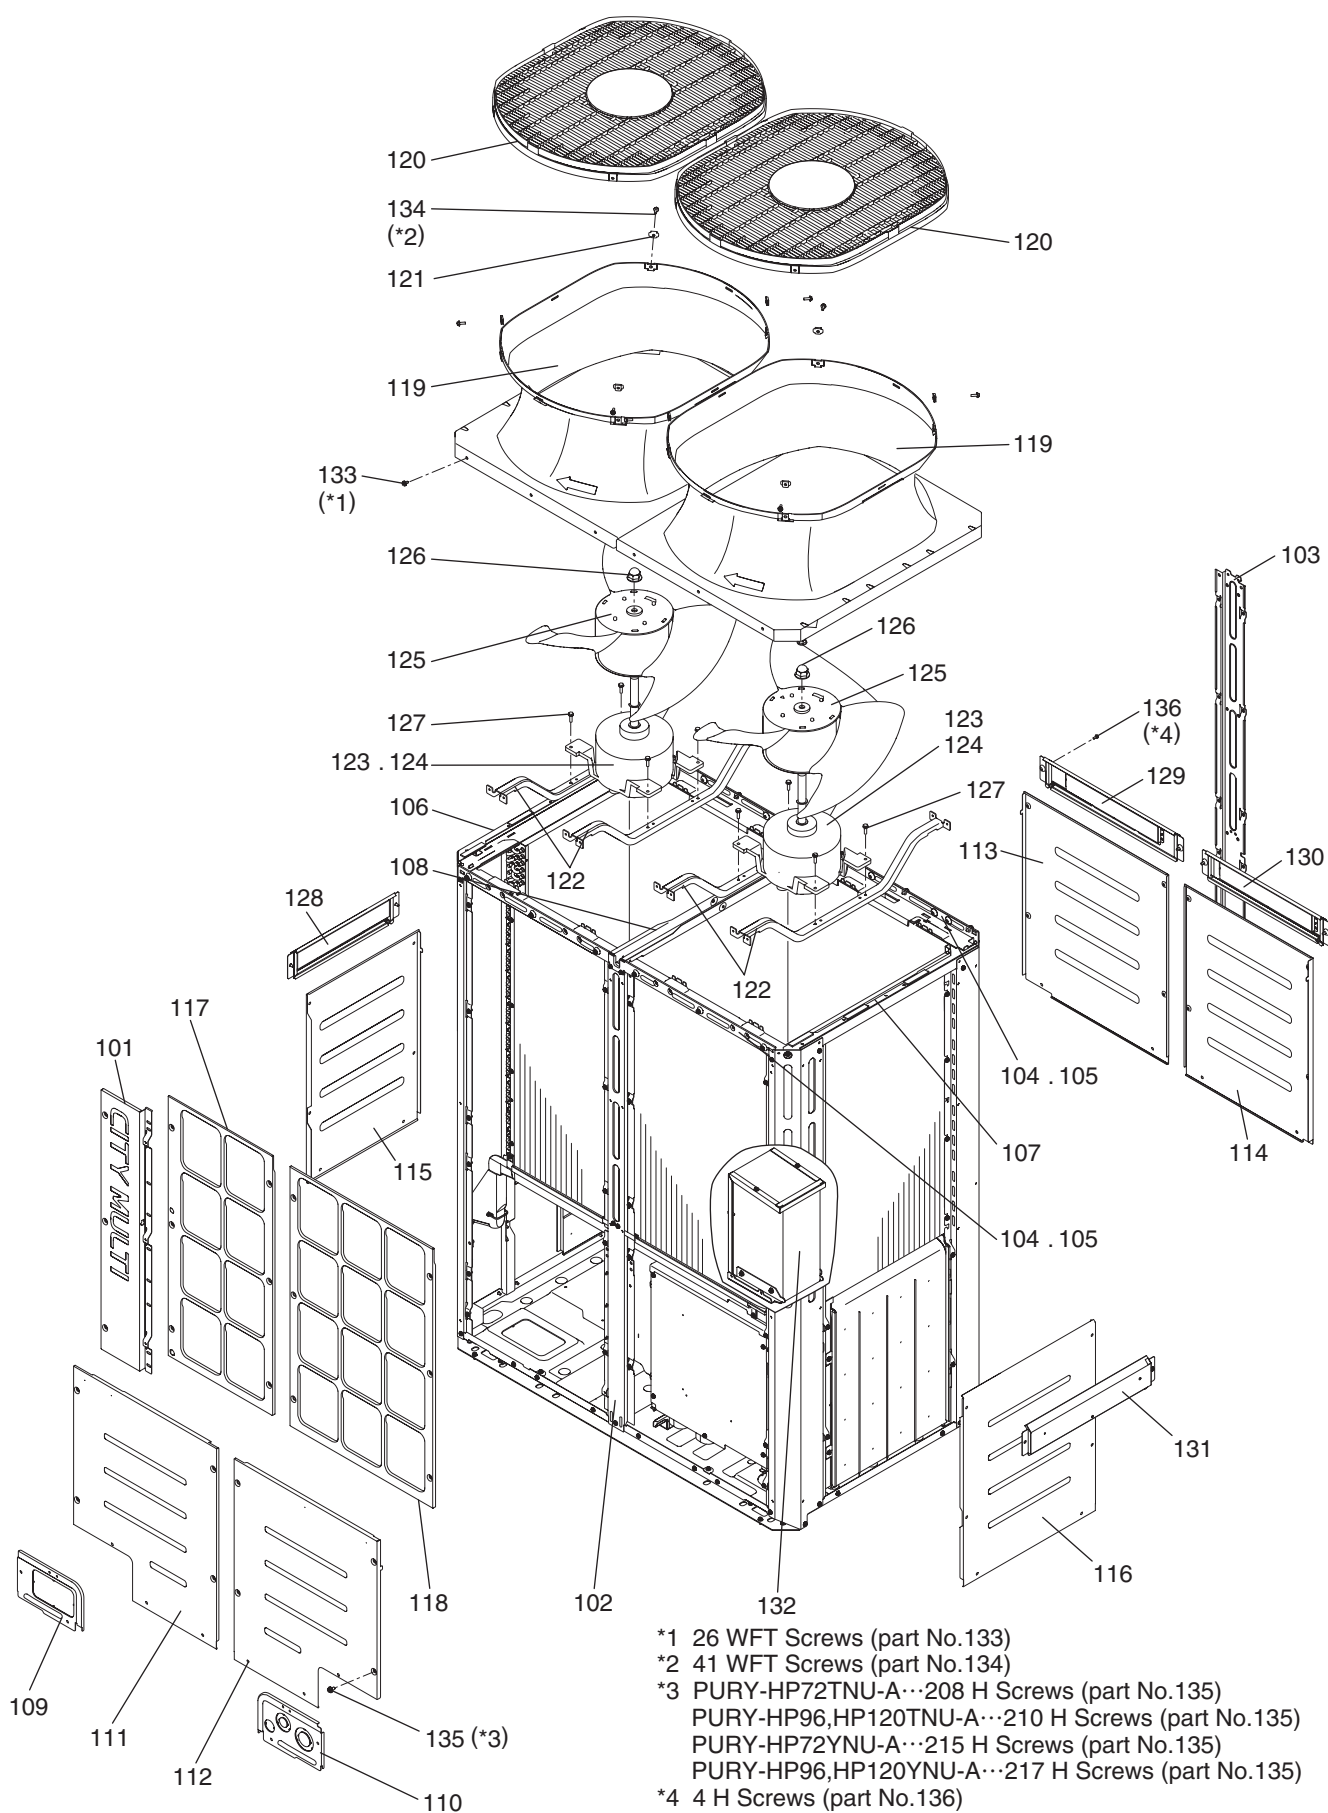


PURY-HP72,HP96,HP120TNU-A
PURY-HP72,HP96,HP120YNU-A

EXTERNAL PARTS & BLOWER PARTS (1-1)

[illegible]

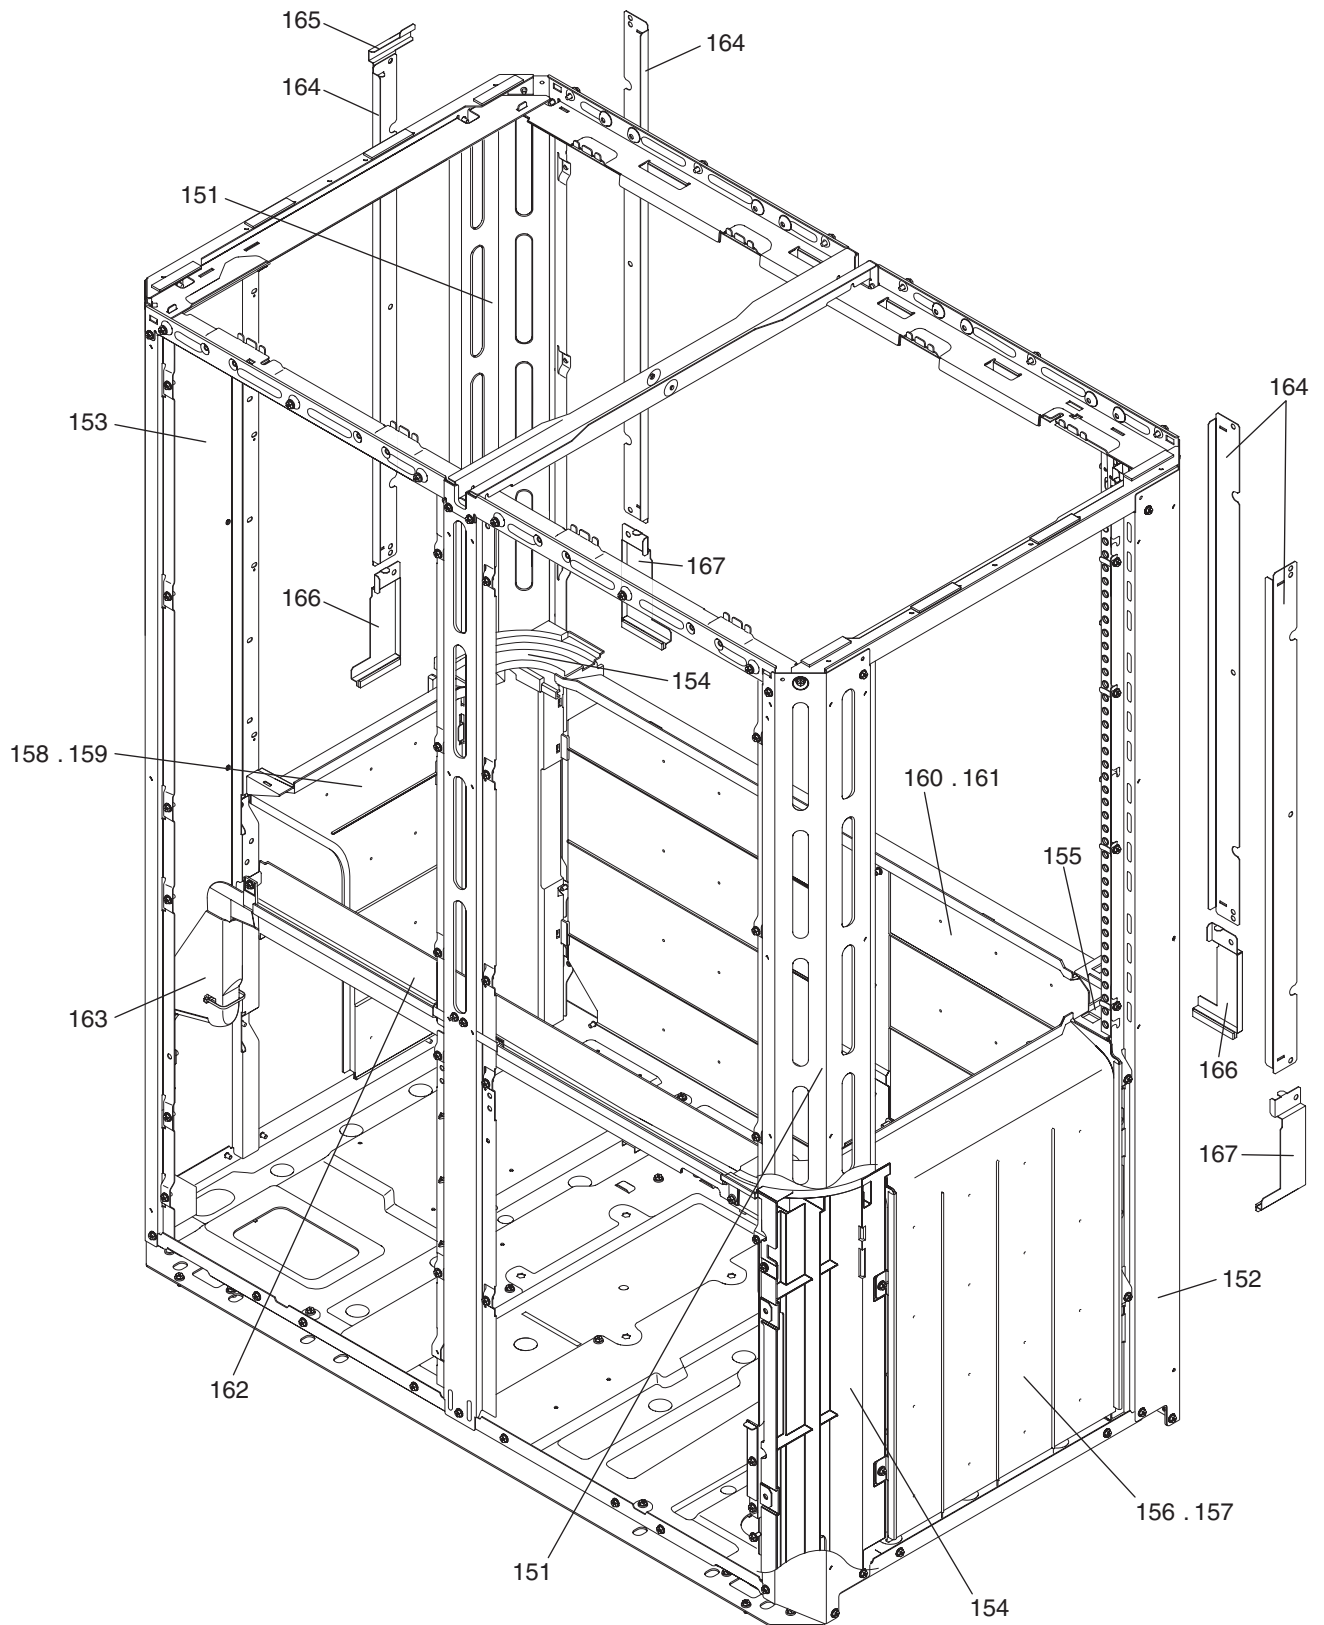




[illegible]

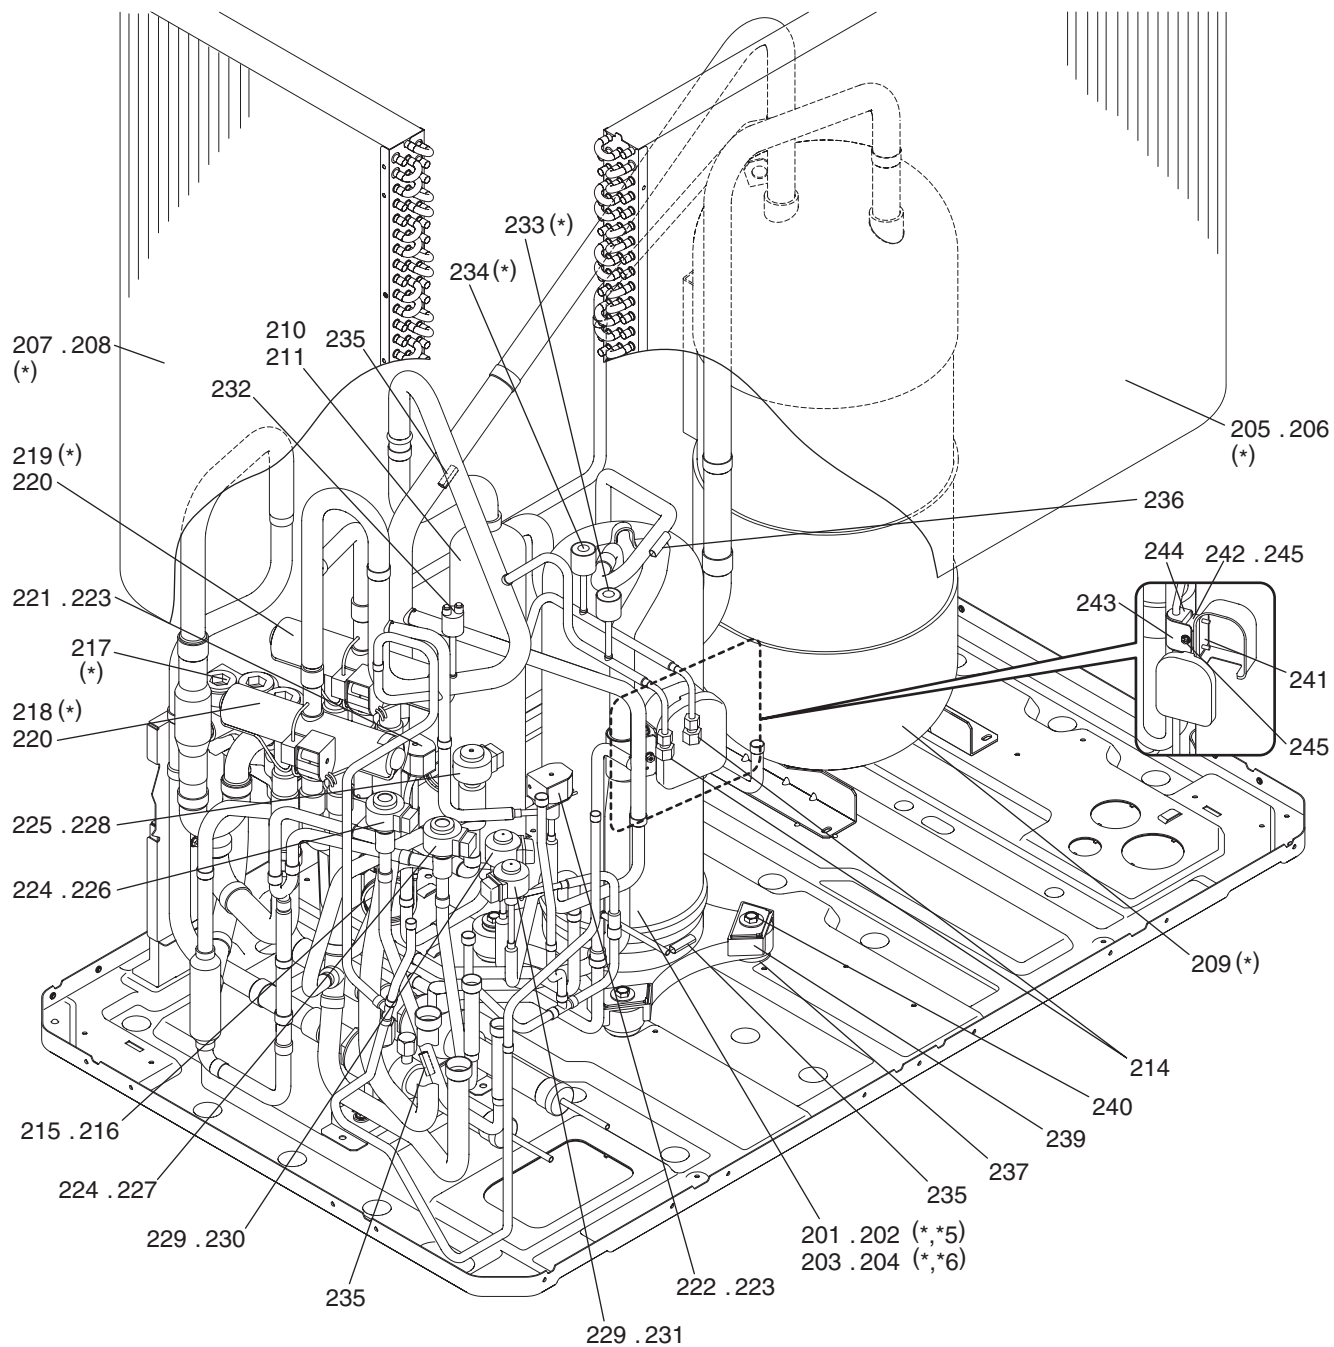

* with instructions

*5 208/230V


*6 460V

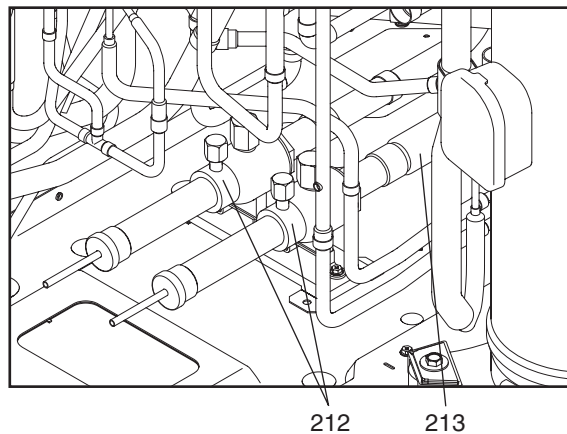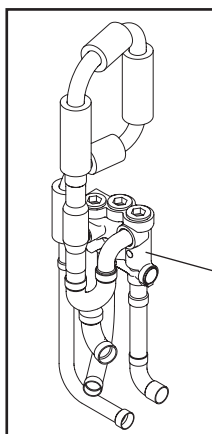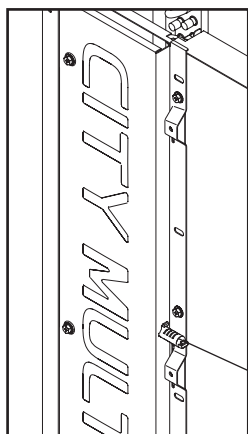

No.	Part No.	Part Name	Spec.	PURY-HP72TNU-A	PURY-HP96TNU-A	PURY-HP120TNU-A	PURY-HP72YNU-A	PURY-HP96YNU-A	PURY-HP120YNU-A	Dwg. No.	Notes for the models	Revision info.
201	R69 189 478	Scroll compressor SP kit	HNK68FB-U	1						EP10175B05	*,*5 208/230V	
202	R69 236 478	Scroll compressor SP kit	HNK97FB2-U		1	1				EP10177B13	*,*5 208/230V	Chg.
203	R69 191 478	Scroll compressor SP kit	HNK68FB-YE				1			EP10175B07	*,*6 460V	
204	R69 237 478	Scroll compressor SP kit	HNK97FB3-YE					1	1	EP10177B18	*,*6 460V	Chg.
205	R61 F55 480	Heat exchanger SP kit	2L F	1			1			KJ00H791G03	*	
206	R61 F57 480	Heat exchanger SP kit	3L F		1	1		1	1	KJ00H793G03	*	
207	R61 F59 480	Heat exchanger SP kit	2L R	1			1			KJ00H792G03	*	
208	R61 F61 480	Heat exchanger SP kit	3L R		1	1		1	1	KJ00H794G03	*	
209	R61 173 484	Accumulator assy SP kit		1	1	1	1	1	1	KS00D242G21	*	
210	R61 060 487	Oil separator assy		1			1			KL00L207G01		
211	R61 061 487	Oil separator assy			1	1		1	1	KL00L287G01		
212	R61 019 410	Ball valve	SBV10-005	2	2	2	2	2	2	P636404X01	<BV1,2>	
213	R61 015 454	Strainer	28.6D-25.4D	1	1	1	1	1	1	P641144X01	<ST1>	
214	R61 007 413	Check joint L	TCJ-2GME-5	2	2	2	2	2	2	KR50C388H01	<CJ1,2>	
215	R63 002 425	Capillary tube assy		1			1			KB49F229G01	<CP1>	
216	R61 014 425	Capillary tube assy			1	1		1	1	KB49M503G01	<CP1>	
217	R61 092 418	CV block SP kit		1	1	1	1	1	1	KS00D243G02	<CV BLOCK,CV5a>*	
218	R61 020 403	Four way valve A SP kit		1	1	1	1	1	1	KS00D244G03	<21S4a>*	
219	R61 021 403	Four way valve B SP kit		1	1	1	1	1	1	KS00D244G04	<21S4b>*	
220	R61 019 242	Four way valve coil	SQ-A2520D-000028-RK	2	2	2	2	2	2	P472128X01	<21S4a,b>	
221	R63 046 232	Solenoid valve	FDF2A77	1	1	1	1	1	1	P631312X01	<SV1a>	
222	R13 018 921	Solenoid valve	FDF4A-016-RK	1	1	1	1	1	1	P631311X01	<SV2>	
223	R61 069 243	Solenoid valve coil	FQ-A0120D-001734-RK	2	2	2	2	2	2	P472129X01	<SV1a,2>	
224	R61 107 401	Linear expansion valve	PAM-BB0YGMD-2	2	2	2	2	2	2	KR50C486H01	<LEV2a,2b>	
225	R61 112 401	Linear expansion valve	PDM-BD130MD-1	1	1	1	1	1	1	P632630X01	<LEV2d>	
226	R61 142 401	Linear expansion valve coil	PAM-MD12MD-17	1	1	1	1	1	1	P472109X01	<LEV2a>	Chg.
227	R61 143 401	Linear expansion valve coil	PAM-MD12MD-18	1	1	1	1	1	1	P472110X01	<LEV2b>	Chg.
228	R61 145 401	Linear expansion valve coil	PAM-MD12MD-20	1	1	1	1	1	1	P472112X01	<LEV2d>	Chg.
229	R63 R34 401	Linear expansion valve	CAM-B35YGMD-2	2	2	2	2	2	2	P632416X01	<LEV4,9>	
230	R61 120 401	Linear expansion valve coil	CAM-MD12MD-128	1	1	1	1	1	1	P472131X01	<LEV4>	
231	R61 111 401	Linear expansion valve coil	CAM-MD12MD-125	1	1	1	1	1	1	P472113X01	<LEV9>	
232	R61 052 208	Pressure switch	ACB-1UB179W	1	1	1	1	1	1	P426346X01	<63H>	
233	R61 098 288	Pressure sensor	NSK-BH042D-501	1	1	1	1	1	1	KB00H904G32	<63HS>*	
234	R61 138 288	Pressure sensor	NSK-BH017D-602	1	1	1	1	1	1	KB00H904G33	<63LS>*	Chg.
235	R61 345 200	Thermistor	PXM-41E-M112-1Y	4	4	4	4	4	4	P418167X01	<TH3,5,7,15>	
236	R63 911 202	Thermistor		1	1	1	1	1	1	P425416X02	<TH4>	
237	R63 852 860	Rubber mount		4	4	4	4	4	4	W897574H01	For compressor	
238	R61 001 310	Sensor holder		1	1	1	1	1	1	KB25B471H04		Chg.
239	R61 027 155	Attachment (HH)		2	2	2	2	2	2	KJ00F713G04		
240	R61 009 306	Bolt	M6	4	4	4	4	4	4	KJ12F711H05		
241	R61 001 132	Attachment		1	1	1	1	1	1	KB02K008H01		
242	R61 005 609	Attachment Saddle		1	1	1	1	1	1	KL00L214G03		
243	R61 003 456	Saddle		1	1	1	1	1	1	KJ02K540H01		
244	R11 934 905	Packing		2	2	2	2	2	2	W483653G03		
245	R61 010 087	Screw upset	M5 × 12	3	3	3	3	3	3	S516322H01		

PURY-HP72TNU-A
PURY-HP96TNU-A
PURY-HP120TNU-A

CONTROL BOX PARTS (1)

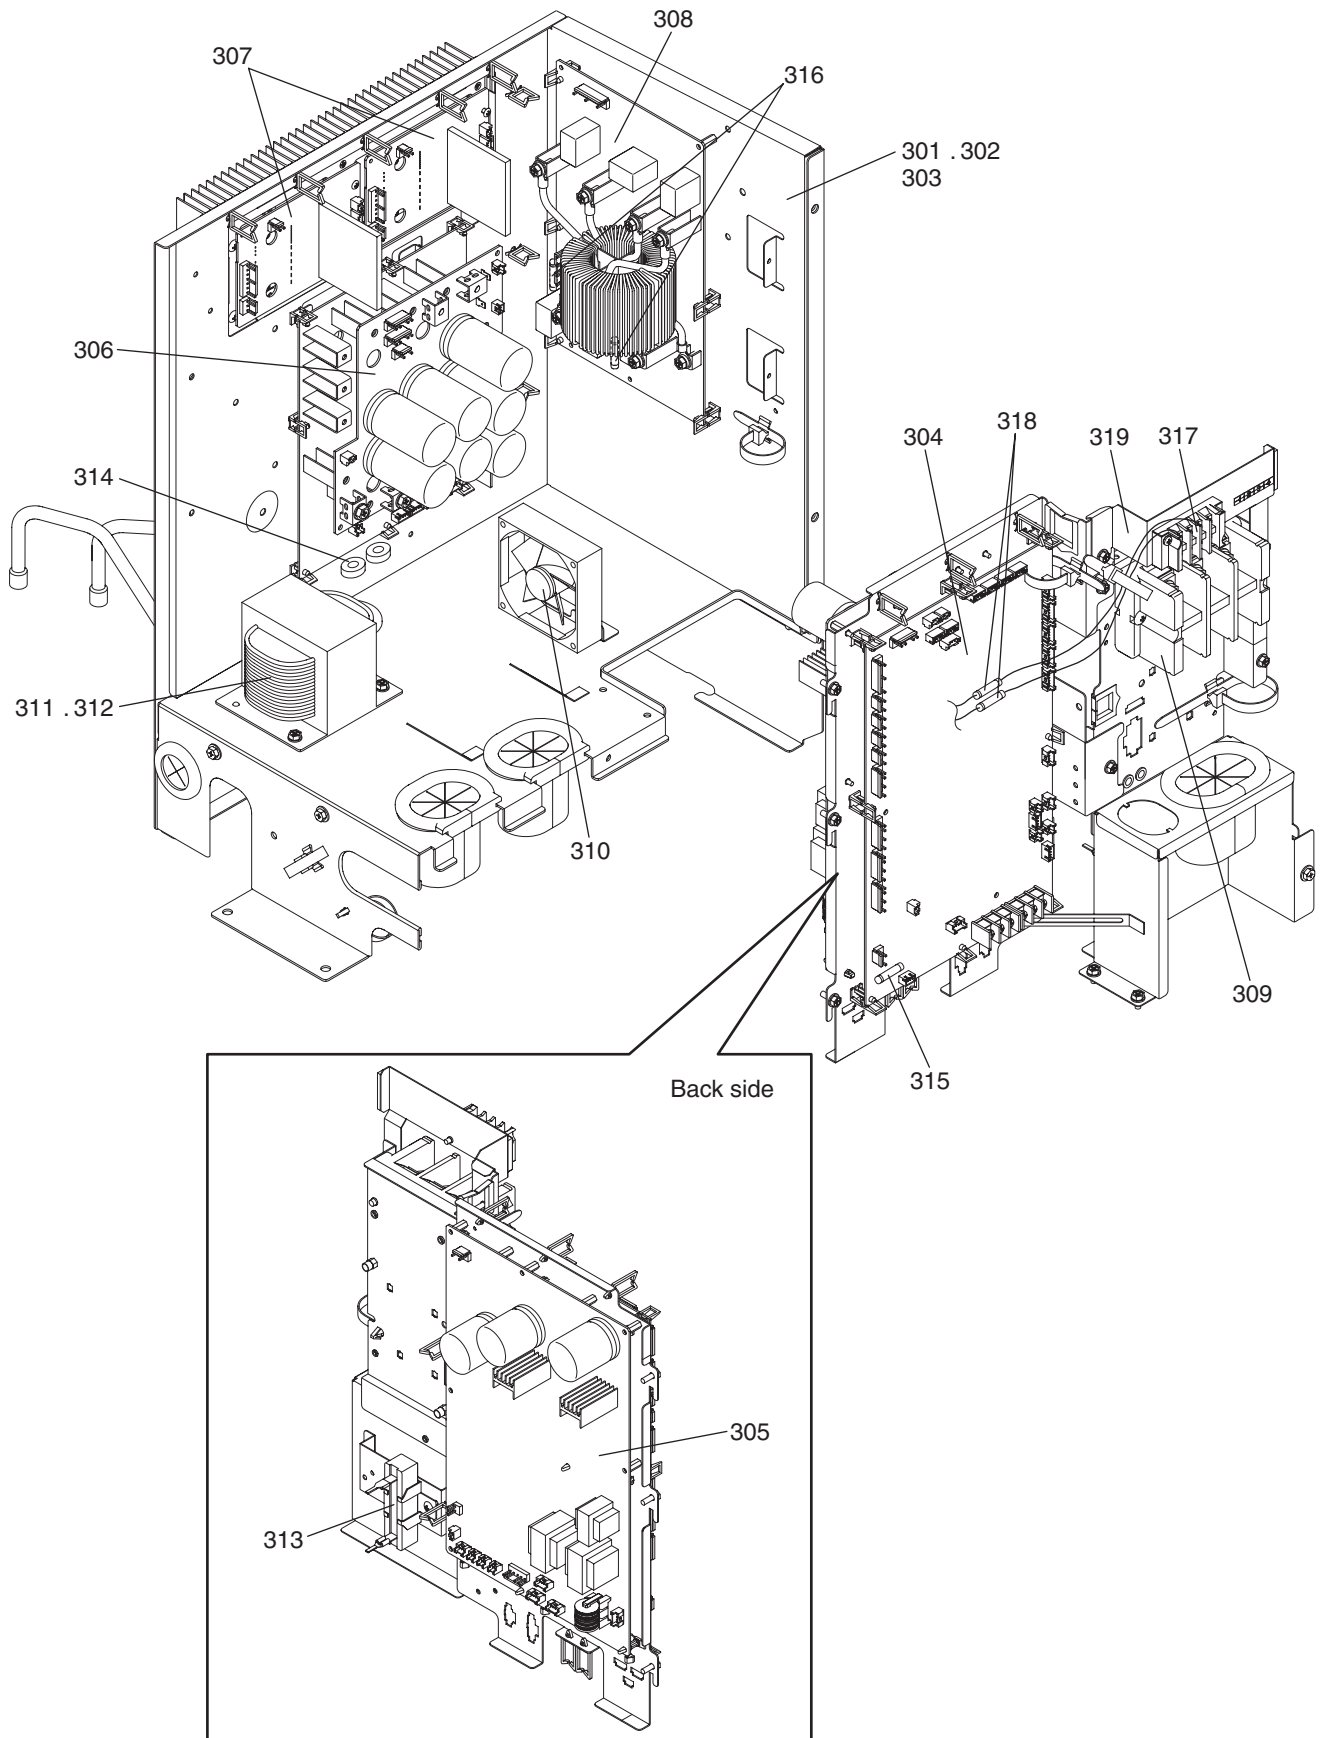

Notice: Consult your service agency when the wiring needs to be replaced.
(Replacing wiring will take about 2 months.)


PURY-HP72TNU-A
PURY-HP96TNU-A
PURY-HP120TNU-A

CONTROL BOX PARTS (1)

[illegible]

PURY-HP72YNU-A
 PURY-HP96YNU-A
 PURY-HP120YNU-A

CONTROL BOX PARTS (2)

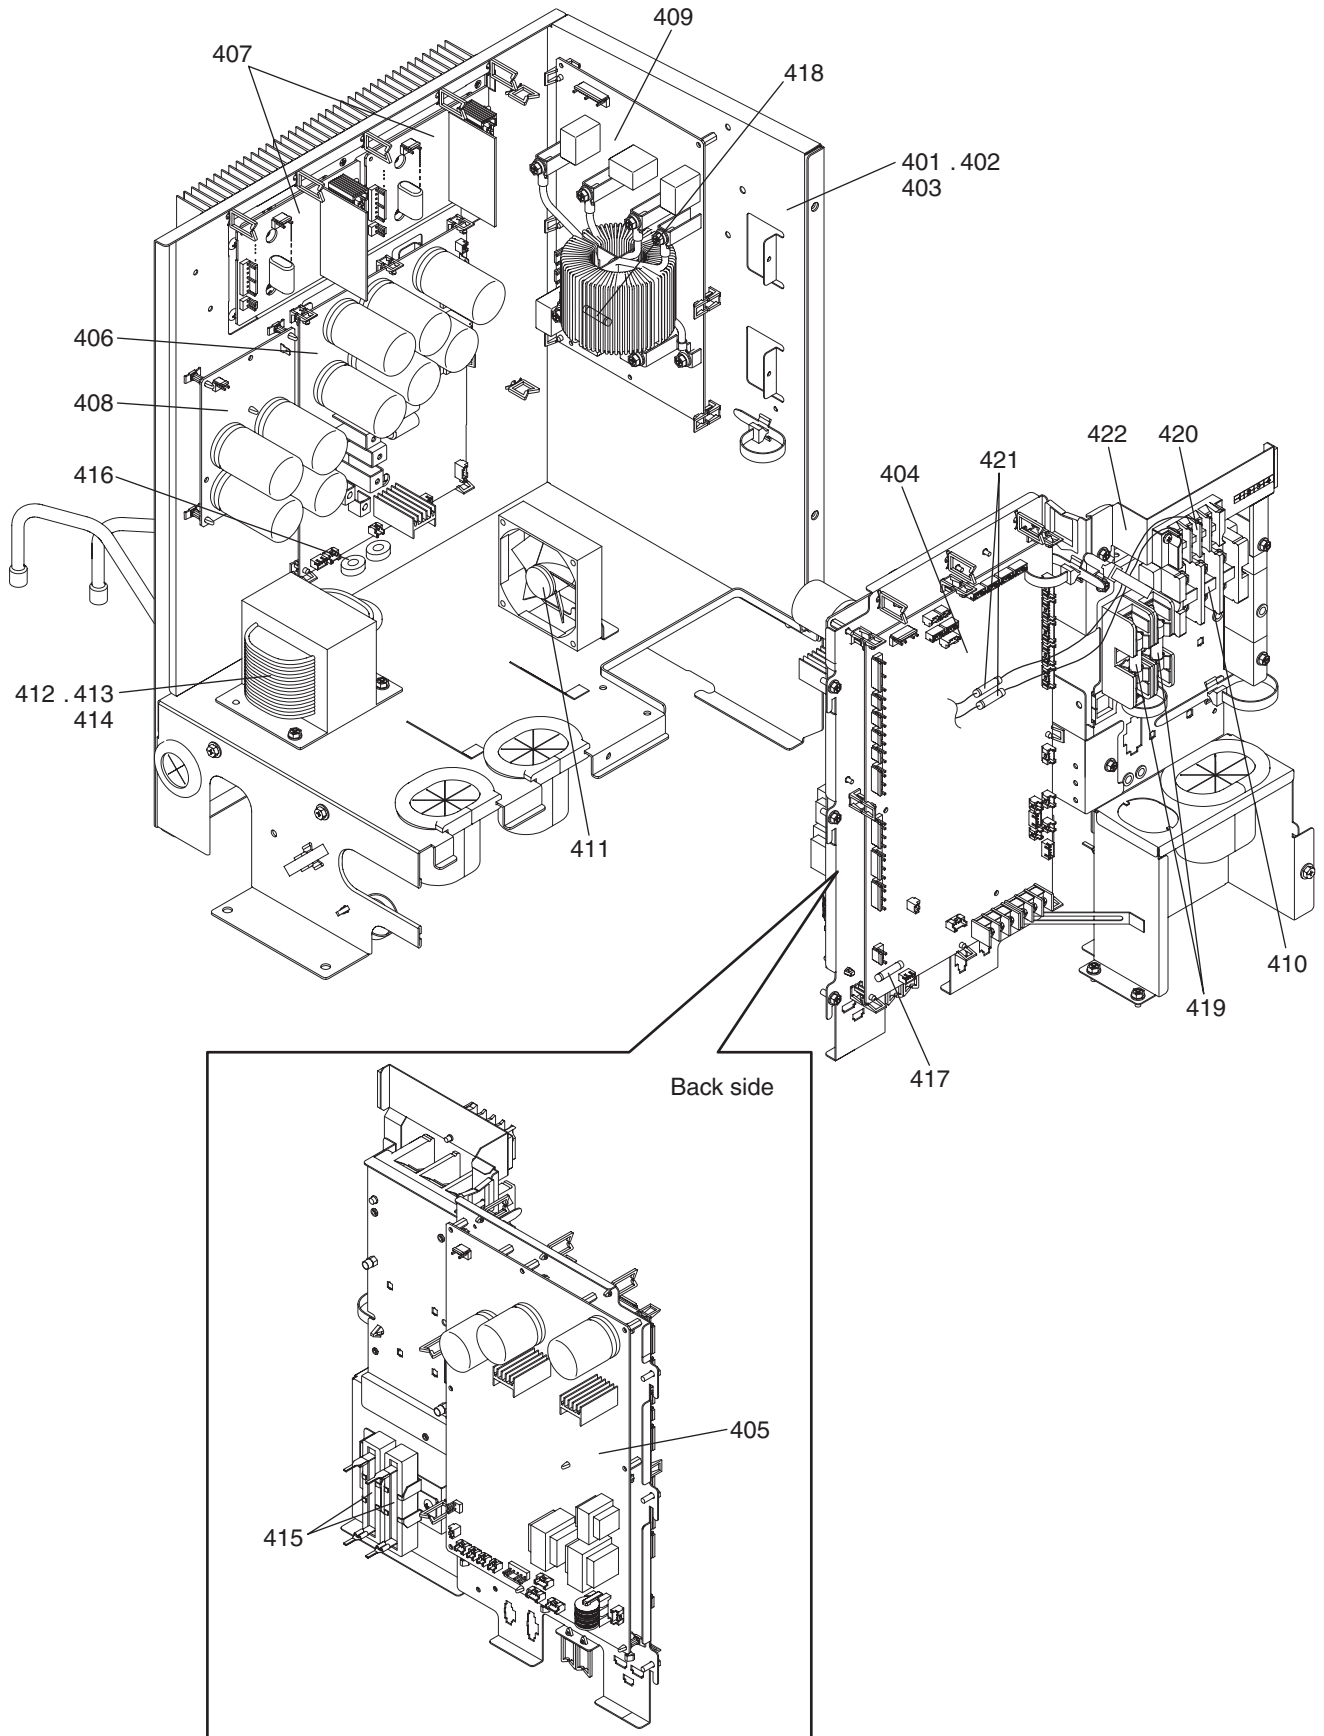

Notice: Consult your service agency when the wiring needs to be replaced.
 (Replacing wiring will take about 2 months.)

CONTROL BOX PARTS (2)

10

mitsubishi **electric** **corporation**

BWE01906A (20240531)